

Bulletin Number: CAN 018-Rev 1

Date: January 28, 2008

Description: FVIR Manifold Kit Assemblies for product manufactured prior to March 2006

For conventional or atmospheric vented water heaters manufactured prior to March 2006; (units that have a thermocouple with a left hand thread and built-in thermal cutoff (TCO) switch) If the thermocouple is out of position or not functioning, GSW recommends that the complete manifold/door assembly should be replaced with the latest components. Current manifold / door assemblies use a traditional thermocouple with a right hand thread that does not require special routing. The resettable thermal cut-off switch is mounted to the outside of the door. Much less time is required to replace the manifold / door assembly over replacing the combination TCO / thermocouple. The below list provide detailed information for ordering the assemblies.

Old Models	Capacity (USG)	Form Factor	Colour	Old Kit p/n	New Kit p/n
G630S30FV-02, JW30S30FV-02	30	Short	Violet	20244	58988
G630S27FV-04	30	Short			
G640T40FV-02, G940T40FV-02, JW40T40FV-02	40	Tall	Blue	20244	58989
G640T36FV-04, JW40T36FV-04, G940T36FV-04	40	Tall	Green	20244	58990
G640S38FV-02, JW40S38FV-02, G940S38FV-02, G940S34FV-04,	40	Short	Orange	20264	58992
JW40S34FV-04, G640S34FV-04, G940S34FV-04, G1240S34FV-04	40	Short	Violet	20264	58991
G640S31FV-06	40	Short			
G950T40FV-02, G650T40FV-02, JW50T40FV-02	50	Tall	Orange	20264	58992
JW50T36FV-04, G650T36FV-04, G950T36FV-04	50	Tall			
G650S40FV-02, JW50S40FV-02, G950S40FV-02,	50	Short	Orange	20266	58994
JW50S36FV-04, G650S36FV-04, G950S36FV-04, G1250S36FV094	50	Short	Violet	20266	58993

For a detailed pilot outage check list please refer to technical bulletin TB 016.

For additional information or any specific questions that you may have, please call our Customer Service Department at (888) 599-2837.